## win7 or 10 2.txt

When upgrading or swapping computers, back these directories up

backup these folders (versions 5.6 and higher)

C:\Users\Public\Documents\Zeiss\CALYPSO\Config
users, probe rack... VERY IMPORTANT

C:\Users\Public\Documents\Zeiss\CALYPSO\workarea\basesystems <<saved alignments

C:\Users\Public\Documents\Zeiss\CALYPSO\protocol\protform <<< customer header info

Do not merge folders, If folders exist on the new pc, rename them and replace with the original

#2 - IP address for NIC card that is plugged into the Zeiss machine must be: 192.4.1.199, submask 255.255.255.0

Dont forget the software dongle usb device.. this might me plugged in on the inside of your computer if its a Zeiss provided PC.

#3 - >>> not necessary if you are installing an existing version on a new pc- the license file(s) (xxxxxxxxx.lic) must be moved over.. its located in the c:program data\zeiss\license directory. This is a hidden directory that must be shown to see the files...

TURN ON WINDOWS SECURITY CENTER SERVICE WINDOWS SECURITY

CANT BESTARTED

DEFENDER

THIS APP IS TURNED OFF BY GROUP POLICY